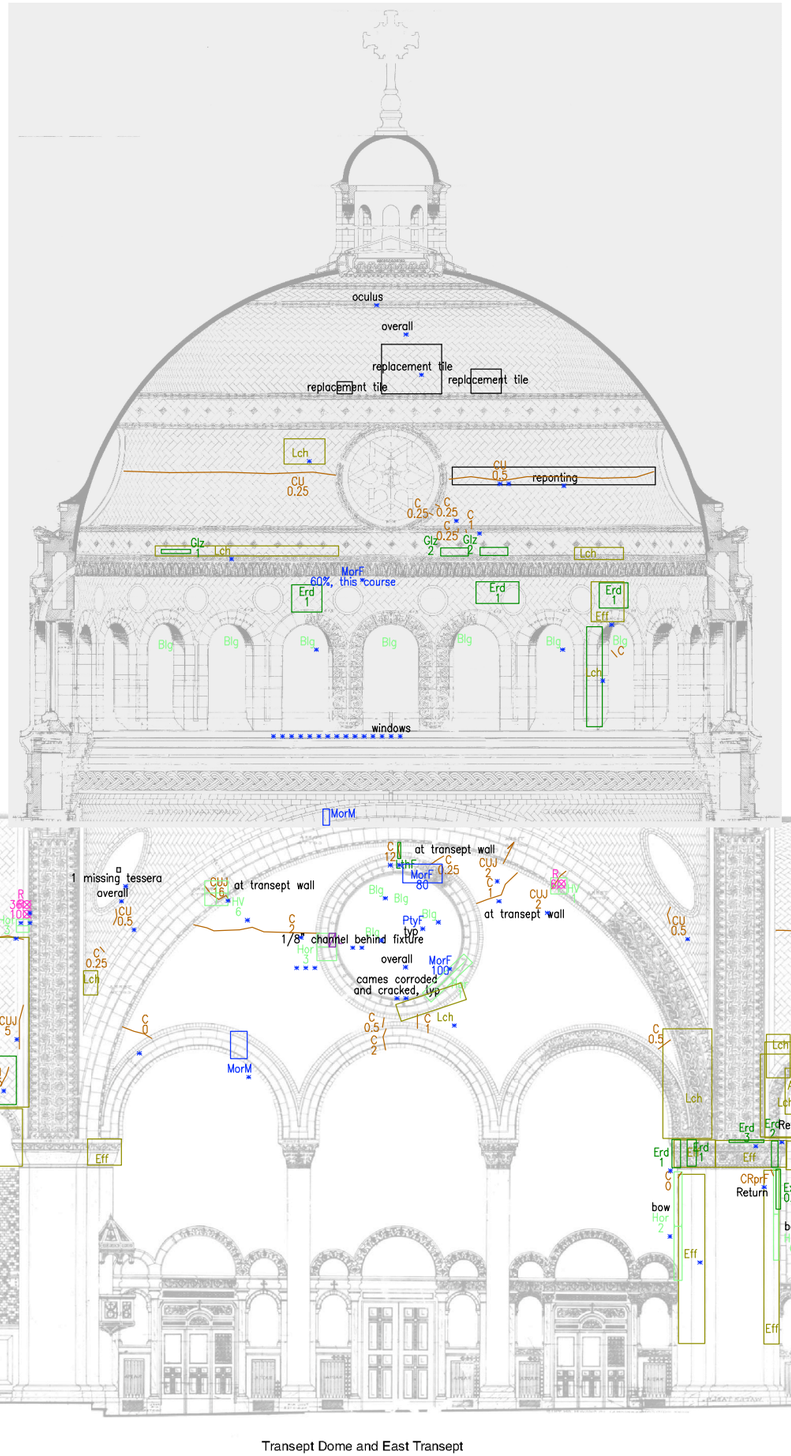

1: WEST-FACING WALLS AND VAULTS

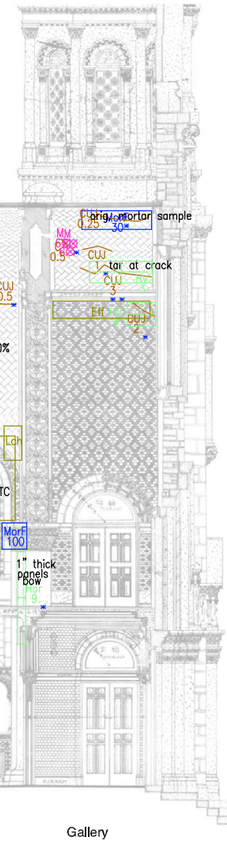

KEY PLAN

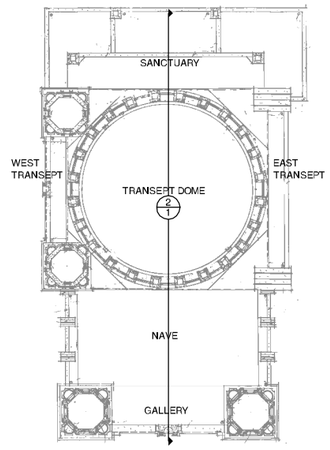

KEY TO SYMBOLS

Each annotation is comprised of a graphical symbol and a text label.

Three types of graphical symbols are used:
- Target Symbols depict faults having small, discrete locations. Examples include spalls, individual failed fasteners, or punctures in sheet metal.
- Box Symbols are rectangular symbols delineating conditions that span an area too large to be effectively represented with target symbols.
- Polyline Symbols are used to depict cracks and specific joint conditions.

Each text label includes a fault code describing the type of condition, and if applicable, a severity code and Picture Link.

This target symbol indicates a 20 square inch spall, which was removed during the survey and photographed:

This box symbol indicates an area of biological soiling, which was not photographed:

This polyline indicates a crack system following a joint path, 3/16 inch wide, which was photographed:

KEY TO SURVEY CODES: MASONRY

Condition	Symbol	Fault Type		Severity	Amount
Coating Failed		CoatF	Coating Failed	Not applicable	Area in sq.ft.
Cracks		C	Crack	Width in 1/16" increments:	
		CJ	Crack system: Joints	0 Hairline	
		CU	Crack system: Units	.5 Hairline to 1/32 inch	Length in lin.ft.
		CUJ	Crack sys.: Units & Joints	1 1/32 to 1/8 inch	
		CRpr	Crack Repair	2 1/16 to 1/8 inch	
		CRprF	Crack Repair Failed		
Displacement		Hor	Horizontal displacement	Disp. in 1/8" increments	
		Vrt	Vertical displacement	1 1/8 to 1/4 inch	Number of units
		HV	Horiz. & Vert.disp.	2 1/8 to 1/4 inch	
Joints Failed		MorF	Mortar Failed	Not applicable	Percentage
		MorM	Mortar Missing		Length in lin.ft.
Prev. Repairs		PF	Patch Failed	Size in square inches	Not applicable
Soiled/Stained		Atm	Atmospheric		
		Bit	Bituminous		
		Cpr	Copper	Not applicable	Area in sq.ft.
		Eff	Efflorescence		
		Lch	Leached Salts		
		Rst	Rust		
Spalls		I	Incipient	Size of spall	
		M	Missing	in square inches	Not applicable
		R	Removed		
Surface Loss		Chp	Chipped		
		Erd	Eroded	Depth of loss	
		Exf	Exfoliated	in 1/8" increments	Area in sq.ft.
		Fri	Friable		
		Glz	Glaze loss		
Unsecured	H N	Hol	Hollow		
		L	Loose	Not applicable	Area in sq.ft.
		R	Removed		

KEY TO SURVEY CODES: GLASS

Condition	Symbol	Fault Type		Severity	Amount
Broken		Brg	Broken	N/A	N/A
Crack		C	Crack	N/A	N/A
Putty Failed		PtyF	Putty Failed	N/A	Length in lin.ft.

KEY TO SURVEY CODES: PLASTER

Condition	Symbol	Fault Type		Severity	Amount
Crack		C	Crack	Width in 1/16" increments	Length in lin.ft.
Lath Failed		LthF	Lath Failed	Not applicable	Area in sq.ft.

VERTICAL ACCESS

SURVEYED USING tpas®
SURVEY NOVEMBER 2006 BY: EK

PO Box 4135 Ithaca, NY 14850
607.257.4049 www.verticalaccess.com

ISSUE DATE: NOVEMBER 2006

INTERIOR ELEVATION
CONDITION SURVEY

BACKGROUND DRAWINGS: CLIENT PROVIDED, SCANNED IMAGE SCALE: REDUCED PLOT, NOT TO SCALE

Building Use: Religious
Architectural Style: Neoclassical
Materials: Brick, Tile, Plaster, Glass

VA PROJECT NUMBER:

2